

# HD48XX - HD49XX SERIES



HD4807T..., HD48V07T..., HD48S07T..., HD4801T..., HD48V01T..., HD4817T..., HD48V17T..., HD4877T... HD48V77T..., HD4907T..., HD4901T..., HD4917T..., HD4977T...

# PASSIVE OR ACTIVE TEMPERATURE, RELATIVE HUMIDITY, RELATIVE HUMIDITY AND TEMPERATURE, TEMPERATURE AND DEW POINT TRANSMITTERS

HD48.. and HD49.. series of transmitters measure temperature, relative humidity and the dew point temperature.

Versions with only standard analog output or with only RS485 output with **MODBUS- RTU** protocol are available. The models with analog output provide a signal suitable for transmission to a remote display, recorder or PLC. The models with RS485 output are suitable for connection to a PC or PLC.

The models of the **HD48..** series are active transmitters and accept both direct and 24Vac alternating power supply; they have standard current (4...20mA) or voltage (0...10V) outputs, or a serial RS485 output, depending on the model. The models of **the HD49..** series are **passive** transmitters and thus suitable to be inserted in a 4...20mA current loop. The HD48.. and HD49.. series of transmitters are designed for temperature and humidity control in conditioning and ventilation applications (HVAC/BEMS) in the following sectors: pharmacy, museums, clean rooms, ventilation ducts, industrial and civil sectors, crowded places, canteens, auditoria, gyms, high-density farms, greenhouses, etc.

The HD48.. and HD49.. transmitters measure relative humidity with a well proven temperature compensated capacitive sensor that assures precise and reliable measurements in the course of time. The transmitters of the HD48.. and HD49.. series are available in two probe temperature ranges: standard -20...+80°C and extended -40...+150°C for the most critical applications. A stainless steel 20µm filter protects the sensors against dust and particles (other filters are available for different applications).

The transmitters are factory calibrated and no further adjustments are required.

Each series is available in three different versions: with horizontal probe for duct mounting (HD48...TO..., HD49...TO...), with vertical probe for wall mounting (HD48...TV..., HD49...TV...) or with remote probe connected to the transmitter by means of a cable (HD48...TC..., HD49...TC...), cable lengths available are 2, 5 and 10m or for the measure of compressed air in pipelines (HD48...TP480, HD49...TP480). The probes can be supplied in two different lengths (135mm or 335mm).

Various accessories are available for the installation: for example to fix the probe to the duct, it can be used the HD9008.31 flange, a 3/8" universal biconical connection or a PG16 metal cable gland ( $\oslash$ 10...14mm). A 4-digit optional display ("L" model) allows to display the measured parameters in a continuous or sequential mode.

#### **Technical specifications**

Technical specifications							
Deletive Unwidity	S1	TANDARD RANGE	EXTENDED RANGE				
Relative Humidity Sensor	Canacitiva						
Measuring range	Capacitive 0100%RH						
Accuracy @T=1535°C	±1.5% RH (090%RH), ±2.0% RH (90100%RH)						
Accuracy @ rest of T range							
Repeatability	0.4%RH						
Sensor working temperature		-20+80°C	-40+150°C				
Temperature							
Measuring range		-20+80°C	-40+150°C				
Sensor	NTC 10kΩ Pt100 class A						
Accuracy	±0.3°C (0+70°C) ±0.4°C (-200°C, +70+80°C) ±0.3°C						
Repeatability	±0.4°C (-200°C, +70+80°C) 0.05°C 0.05°C						
Dew Point							
Sensor	Parameter (	calculated from relative humidity	and temperature				
Measuring range	-20+80°C DP						
Accuracy		See table 1 below					
Repeatability  Type of output (according	to the model)	0.5°C DP					
Models	Temperature	420mA (-20+80°C	), $R_L < 500\Omega$				
HD4807T Models		22mA outside the mea 420mA (-40+150°C	suring range				
HD4807ET Models	Temperature	22mA outside the mea 010Vdc (-20+80°C	śuring range				
HD48V07T	Temperature	11Vdc outside the mea	śuring range				
Models HD48V07ET	Temperature	010Vdc (-40+150° 11Vdc outside the mea					
Models HD48S07T HD48S07ET	Temperature	Only RS485 with MODBU					
Models	Temperature	420mA (-20+80°C), R <sub>L</sub> Ma					
HD4907T Models	Temperature	22mA outside the mea 420mA (-40+150°C), R <sub>I</sub> Ma					
HD4907ET Models HD4801T		22mA outside the mea 420mA (0100%RF	suring range				
HD4801ET	Relative Humidity	22mA outside the mea	suring range				
Models HD48V01T HD48V01ET	Relative Humidity	$010$ Vdc (0100%RH), $R_L > 10$ kΩ 11Vdc outside the measuring range					
Models HD48S01T HD48S01ET	Relative Humidity	Only RS485 with MODBU	S-RTU protocol				
Models HD4901T HD4901ET	Relative Humidity	420mA (0100%RH), R <sub>1</sub> Max = (Vdc-12)/0.022 22mA outside the measuring range					
	Relative Humidity	Relative Humidity 420mA (0100%RH), R <sub>1</sub> < 500Ω					
Models HD4817T	,	Temperature $420$ mA (-20+80°C), $R_L < 500\Omega$					
		22mA outside the mea 420mA (0100%RH	suring range				
Models	22mA outside the measuring range						
HD4817TV	Temperature	22mA outside the mea	suring range				
Models	Relative Humidity	420mA (0100%RH), $R_L$ < 500Ω 22mA outside the measuring range					
HD4817ET	Temperature	420mA (-40+150°C 22mA outside the mea	C), $R_i < 500\Omega$				
	Relative Humidity	010Vdc (0100%RF	$I$ ), $R_{l} > 10k\Omega$				
Models HD48V17T	,	0 10Vdc (-20 +80°C) R > 10kO					
	Temperature	11Vdc outside the measuring range					
Models	Relative Humidity	11Vdc outside the measuring range					
HD48V17ET	Temperature	$010Vdc$ (-40+150°C), $R_L > 10k\Omega$ 11Vdc outside the measuring range					
Models HD48S17T HD48S17ET	Relative Humidity Temperature	Only RS485 with MODBU	S-RTU protocol				
	Relative Humidity	420mA (0100%RH), R <sub>L</sub> Ma					
Models HD4917T	Temperature	22mA outside the mea 420mA (-20+80°C), R <sub>L</sub> Ma	x = (Vdc-12)/0.022				
		22mA outside the mea 420mA (0100%RH), R, Ma	suring range ax = (Vdc-12)/0.022				
Models HD4917TV	Relative Humidity	22mA outside the mea 420mA (0+60°C), R <sub>1</sub> Max	suring range				
INTUIT IV	Temperature	22mA outside the mea	suring range				
Models	Relative Humidity	420mA (0100%RH), R <sub>L</sub> Ma 22mA outside the mea	suring range				
HD4917ET	Temperature	420mA (-40+150°C), R <sub>L</sub> M 22mA outside the mea	ax = (Vdc-12)/0.022				
Models	Dew Point	420mA (-20+80°C [	$P$ ), $R_{i}$ < $500\Omega$				
Models HD4877T	Temperature	22mA outside the measuring range 420mA (-20+80°C), R <sub>1</sub> < 500Ω					
	Temperature	22mA outside the mea 010Vdc (-20+80°C	suring range				
Models HD48V77T	Dew Point	11Vdc outside the mea 010Vdc (-20+80°C	suring range				
	Temperature						
Models HD48S77T	Dew Point Temperature						
	Dew Point	420mA (-20+80°C DP), R <sub>L</sub> I					
Models HD4977T	Temperature	22mA outside the mea 420mA (-20+80°C), R, Ma	ax = (Vdc-12)/0.022				
		22mA outside the rhea 420mA (-40+60°C D	suring range PP), R <sub>i</sub> < 500Ω				
Models HD4877T480	Dew Point	22mA outside the mea 420mA (-40+60°C	suring range				
11040111400	Temperature	420mA (-40+60°C 22mA outside the mea	suring range				

Models	Dew Point	$\overline{DP}$ ), $R_L > 10kΩ$ suring range		
HD48V77T480	Temperature	010Vdc (-40+60°C I 11Vdc outside the mea 010Vdc (-40+60°C I 11Vdc outside the mea	$DP$ ), $R_L > 10kΩ$ suring range	
Models HD48S77T480	Dew Point Temperature	Only RS485 with MODBU		
Models	Dew Point	420mA (-40+60°C DP), R <sub>L</sub> Max = (Vdc-12)/0 22mA outside the measuring range		
HD4977T480	Temperature	420mA (-40+60°C), R <sub>L</sub> Ma 22mA outside the mea	lax = (Vdc-12)/0.022	
Power supply and electric	al connections			
	HD48		HD49	
Power supply	1840Vdc or 24 Vac ±10%		1240Vdc	
Consuption	- 4mA@24V(models with voltage output) - 4mA@24V with open output, 20mA@24V with 12mA output (models with standards output) - 2mA@24V models with serial RS485 output			
Electrical connections	Screw type terminal block, max 1,5mm², M16 cable gland for input cable			
General specifications				
TV probe working temperature	-20+80°C			
TO,TC Probes working	STANDARD RANGE		EXTENDED RANGE	
temperature		-40+150°C		
T480 probes working temperature	-40+60°C			
Storage temperature	-20+80°C			
electronics protection class	IP66			
Case dimensions	80x84x44			


Table 1 -Accuracy of dew point measurement:

		TD °C								
		-20	-10	0	10	20	30	40	60	80
	-20	≤±1								
	-10	≤±1	≤±1							
၁ <sub>°</sub> є	0	≤±1	≤±1	≤±1		_	DP LIMIT			
=	10	≤±3	≤±1	≤±1	<u>≤±1</u>	DF LIMIT				
_at	20	<u>≤±4</u>	<±2	≤±1	≤±1	≤±1				
Temperature	30		≤±3	≤±1,5	≤±1	≤±1	≤±1			
e.	40				<u>≤±2</u>	≤±1         ≤±1           ≤±2,5         ≤±2         ≤±1         ≤±1				
_	60	NOT	SPECIF	FIED	≤±5					
	80						≤±4	<u>≤</u> ±2	≤±1	≤±1

For example at 20°C a Dew Point value of 0°C DP is measured with an accuracy better than 1°C DP.

# Installation notes

To fix the probe inside a ventilation duct, a pipe, etc., use for example the HD9008.31 flange, a PG16 metal cable gland (Ø10...14mm) or a 3/8" universal biconical connection.

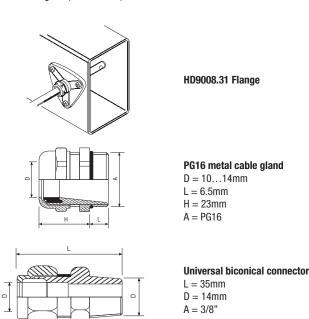


#### **Electrical connections**

HD48.. series with analog output

Power the instrument as shown in the below connection schemes, the power supply terminals are marked as  $\pm Vcc$  and GND.


Depending on the model, the output signal is available between:

- Ta and AGND terminals for the transmitters of the HD4807T..and HD48V07T... series.
- RH% and AGND terminals for the transmitters of the HD4801T.. and HD48V01T.. series.
- RH% and AGND, Ta and AGND terminals for the transmitters of the HD4817T.. and HD48V17T.. series.
- DP and AGND, Ta and AGND terminals for the transmitters of the HD4877T.. and HD48V77T.. series.

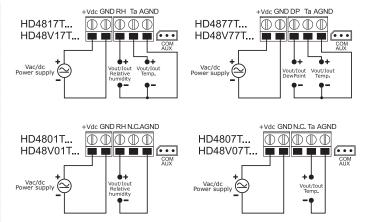


#### HD48...series with RS485 output

Connect the instrument as shown in the below connection schemes, the power supply terminals are marked as +Vcc and GND.



Thanks to RS485 output, several instruments can be connected to form a network. The instruments are connected in a sequence through a shielded cable with twisted pair for signals and a third wire for the mass.

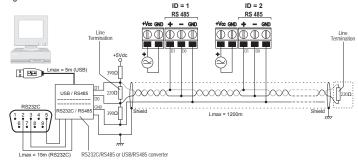


Line termination must be set at the two network ends. To polarize the line during non-transmission periods, resistors are connected between signal and power supply lines.


The maximum number of devices that can be connected to the (Bus) line RS485 depends on the load characteristics of the devices to be connected.

The standard RS485 requires that the total load does not exceed 32 Unit Loads. The load of a HD48S.. transmitter is equal to  $\frac{1}{2}$  of the unit load.

If the total load is more than 32 unit loads, divide the net in segments and insert a signal repeater between one segment and the next one. At the beginning and at the end of each segment a line termination must be connected.

The instrument has a built in line termination that can be connected or removed through a short jumper placed next to the terminal block. If the instrument is the last or the first device of a network group, connect the termination placing the short jumper between the "RT" and "240 ohm" indications. If the instrument is not at the end of a network group, remove the termination placing the short jumper between the "RT" and "OPEN" indications.

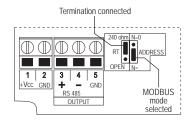



The cable shield must be connected to both line ends. The cable should have the following features:

- Characteristic impedance: 120 ohm
- Capacity: less than 50pF/m
- Resistance: less than 100 ohm/km
- gauge: 0,22 mm2 (AWG24) at least.

The cable maximum length depends on baud rate and cable characteristics. Typically, the maximum length is 1200m. The data line must be kept separated from any power lines in order to prevent interferences on the transmitted signal. For connection to a PC, a RS232/RS485 or a USB/RS485 converter must be used. To operate with the MODBUS-RTU protocol be sure that the ADDRESS short jumper is between "ADDRESS" and "N=" indications.

Each transmitter of the network is univocally identified by an address. The address must be between 1 and 247. There must not be any other transmitters connected with the same address. The address must be configured before connecting the instrument to the network. To set the instrument address use the HD48STCAL kit. The kit includes the RS48 cable with built in USB/RS485 adapter and a CD-ROM for Windows® operating systems. To configure the instrument it is necessary to move the ADDRESS short jumper between the "ADDRESS" and "N=0" indications to select the setup mode. After the configuration, move the short jumper back between the "ADDRESS" and "N=" indications.

In MODBUS mode it is possible to read the measured values by the instrument through the 04h functioning code (Read Input Registers). Table 2 represents the available quantities with its relative register address.


Table 2 - Modbus Registers

Address	Quantities	Format
0	Temperature in °C (x10)	Complete 16 bit
1	Temperature in ° (x10)	Complete 16 bit
2	Relative Humidity in % (x10)	Complete 16 bit
3	Dew Point in °C (x10)	Complete 16 bit
4	Dew Point in °F (x10)	Complete 16 bit
5	State register  Bit 0 = 1 → temperature measure in error  Bit 1 = 1 → relative humidity measure in error  Bit 2 = 1 → dew point temperature calculation in error  Bit 3 = 1 → error in data configuration	Complete 16 bit

#### HD49.. series

Follow the connection schemes shown below, the maximum load resistance that can be connected to each 4...20mA output depends on the power supply Vcc applied, according to the relation:

 $R_1$ Max = (Vdc-12)/0.022, e.g. if Vdc=24Vdc the max load is  $R_1$ Max =545 ohm.

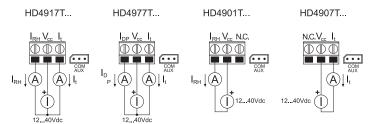


#### Relative humidity probe calibration


The HD48.. and HD49.. transmitters are supplied factory calibrated and ready to use. If necessary, it is possible to calibrate the relative humidity sensor using the saturated salt solutions **HD75** (75% RH saturated salt solution) and **HD33** (33% RH saturated salt solution) by connecting the instrument to the PC and using the HD48TCAL software.






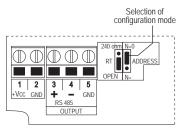


#### Case dimensions

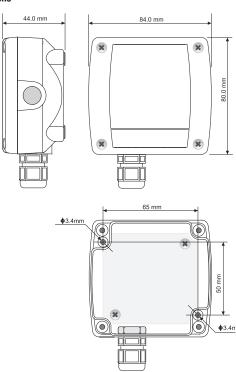


# Probe dimensions: TO series

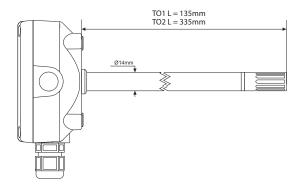


### TC series

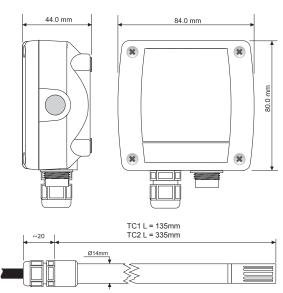

#### **Ordering codes**

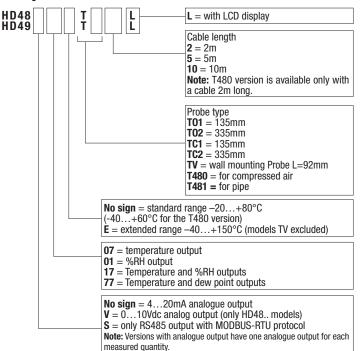

#### TV series

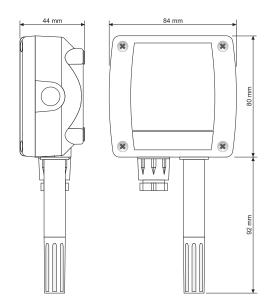



#### Ordering code examples

**HD4801TV:** Wall mounting digital active relative humidity transmitter.

Relative humidity range 0...100%RH.

Analog output: 4...20mA (0...100%RH).

Probe working range -20...+80°C. Power supply 18...40Vdc or 24Vac.

HD4917T01: Digital passive (current loop) temperature and relative humidity transmitter for duct mounting. AlSl304 steel probe, diameter 14mm and stem length 135mm, joined to the electronics enclosure.

Relative humidity range 0...100%RH, temperature range -20...+80°C.

Analog outputs: 4...20mA (0...100%RH) for RH and 4...20mA (-20...+80°C) for temperature. Probe working range -20...+80°C. Power supply 12...40Vdc.

HD4817TC25L: Digital active temperature and relative humidity transmitter with LCD display. AlSi304 steel probe, diameter 14mm and stem length 335mm, connected to the electronics enclosure through a 5m cable.

Relative humidity range 0...100%RH, temperature range -20...+80°C.

Analog outputs: 4...20mA (0...100%RH) for RH and 4...20mA (-20...+80°C) for temperature. Probe working range -20...+80°C. Power supply 18...40Vdc or 24Vac.

HD48V17ETC25: Digital active temperature and relative humidity transmitter, extended range. AlSl304 steel probe, diameter 14mm and stem length 335mm, connected to the electronics enclosure through a 5m cable.

Relative humidity range 0...100%RH, temperature range -40...+150°C.

Analog outputs: 0...10V (0...100%RH) for RH and 0...10V (-40...+150°C) for temperature. Probe working range -40...+150°C. Power supply 18...40Vdc or 24Vac.

HD48S17TC25L: Digital active temperature and relative humidity transmitter with LCD display. AlSl304 steel probe, diameter 14mm and stem length 335mm, connected to the electronics enclosure through a 5m cable.

Relative humidity range 0...100%RH, temperature range -20...+80°C.

Only RS485 output with MODBUS-RTU protocol. Probe temperature working range -20...+80°C. Power supply 18...40Vdc or 24Vac.

HD4877T02: Digital active temperature and dew point transmitter for duct mounting. AlSl304 steel probe, diameter 14mm and stem length 135mm, joined to the electronics enclosure.

Dew point range -20...+80°C DP, temperature range -20...+80°C.

Analog outputs: 4...20mA (-20...80°C DP) for DP and 4...20mA (-20...+80°C) for temperature. Probe working range -20...+80°C. Power supply 18...40Vdc or 24Vac.

HD4977T02: Digital passive (current loop) temperature and dew point transmitter for duct mounting. AlSl304 steel probe, diameter 14mm and stem length 335mm, joined to the electronics enclosure.

Dew point range -20...+80°C DP, temperature range -20...+80°C.

Analog outputs: 4...20mA (-20...+80°C DP) for DP and 4...20mA (-20...+80°C) for temperature. Probe working range -20...+80°C. Power supply 12...40Vdc.

# **Accessories**

RS48: Cable for RS485 serial connection with buit-in USB/RS485 converter.

CP27: Connection/converter cable from COM AUX serial port to USB.

HD75: 75% RH saturated solution for the verification of the relative humidity sensor, complete of screw adaptors for probes with Ø 14mm and Ø 26mm.

HD33: 33% RH saturated solution for the verification of the relative humidity sensor, complete of screw adaptors with Ø 14mm and Ø 26mm.

HD9008.31: Wall flange with cable gland to fix Ø 14mm probes.

PG16: AISI304 steel cable gland for Ø 14mm probes.

**P6:** 10μ sintered stainless steel protection for Ø 14mm probes.

P7: 20μ PTFE protection for Ø 14mm probes.

P8: Stainless steel grid 20µ and Pocan for Ø 14mm probes.

